


T1S, R4W, U.S.B.&M.

ANR PRODUCTION CO.

AS - BUILT
DAMAGE AREA


(For the Fieldstead #2-28A4 Well Site)

LOCATED IN
SECTION 28, T1S, R4W, U.S.B.&M.
DUCESNE COUNTY, UTAH

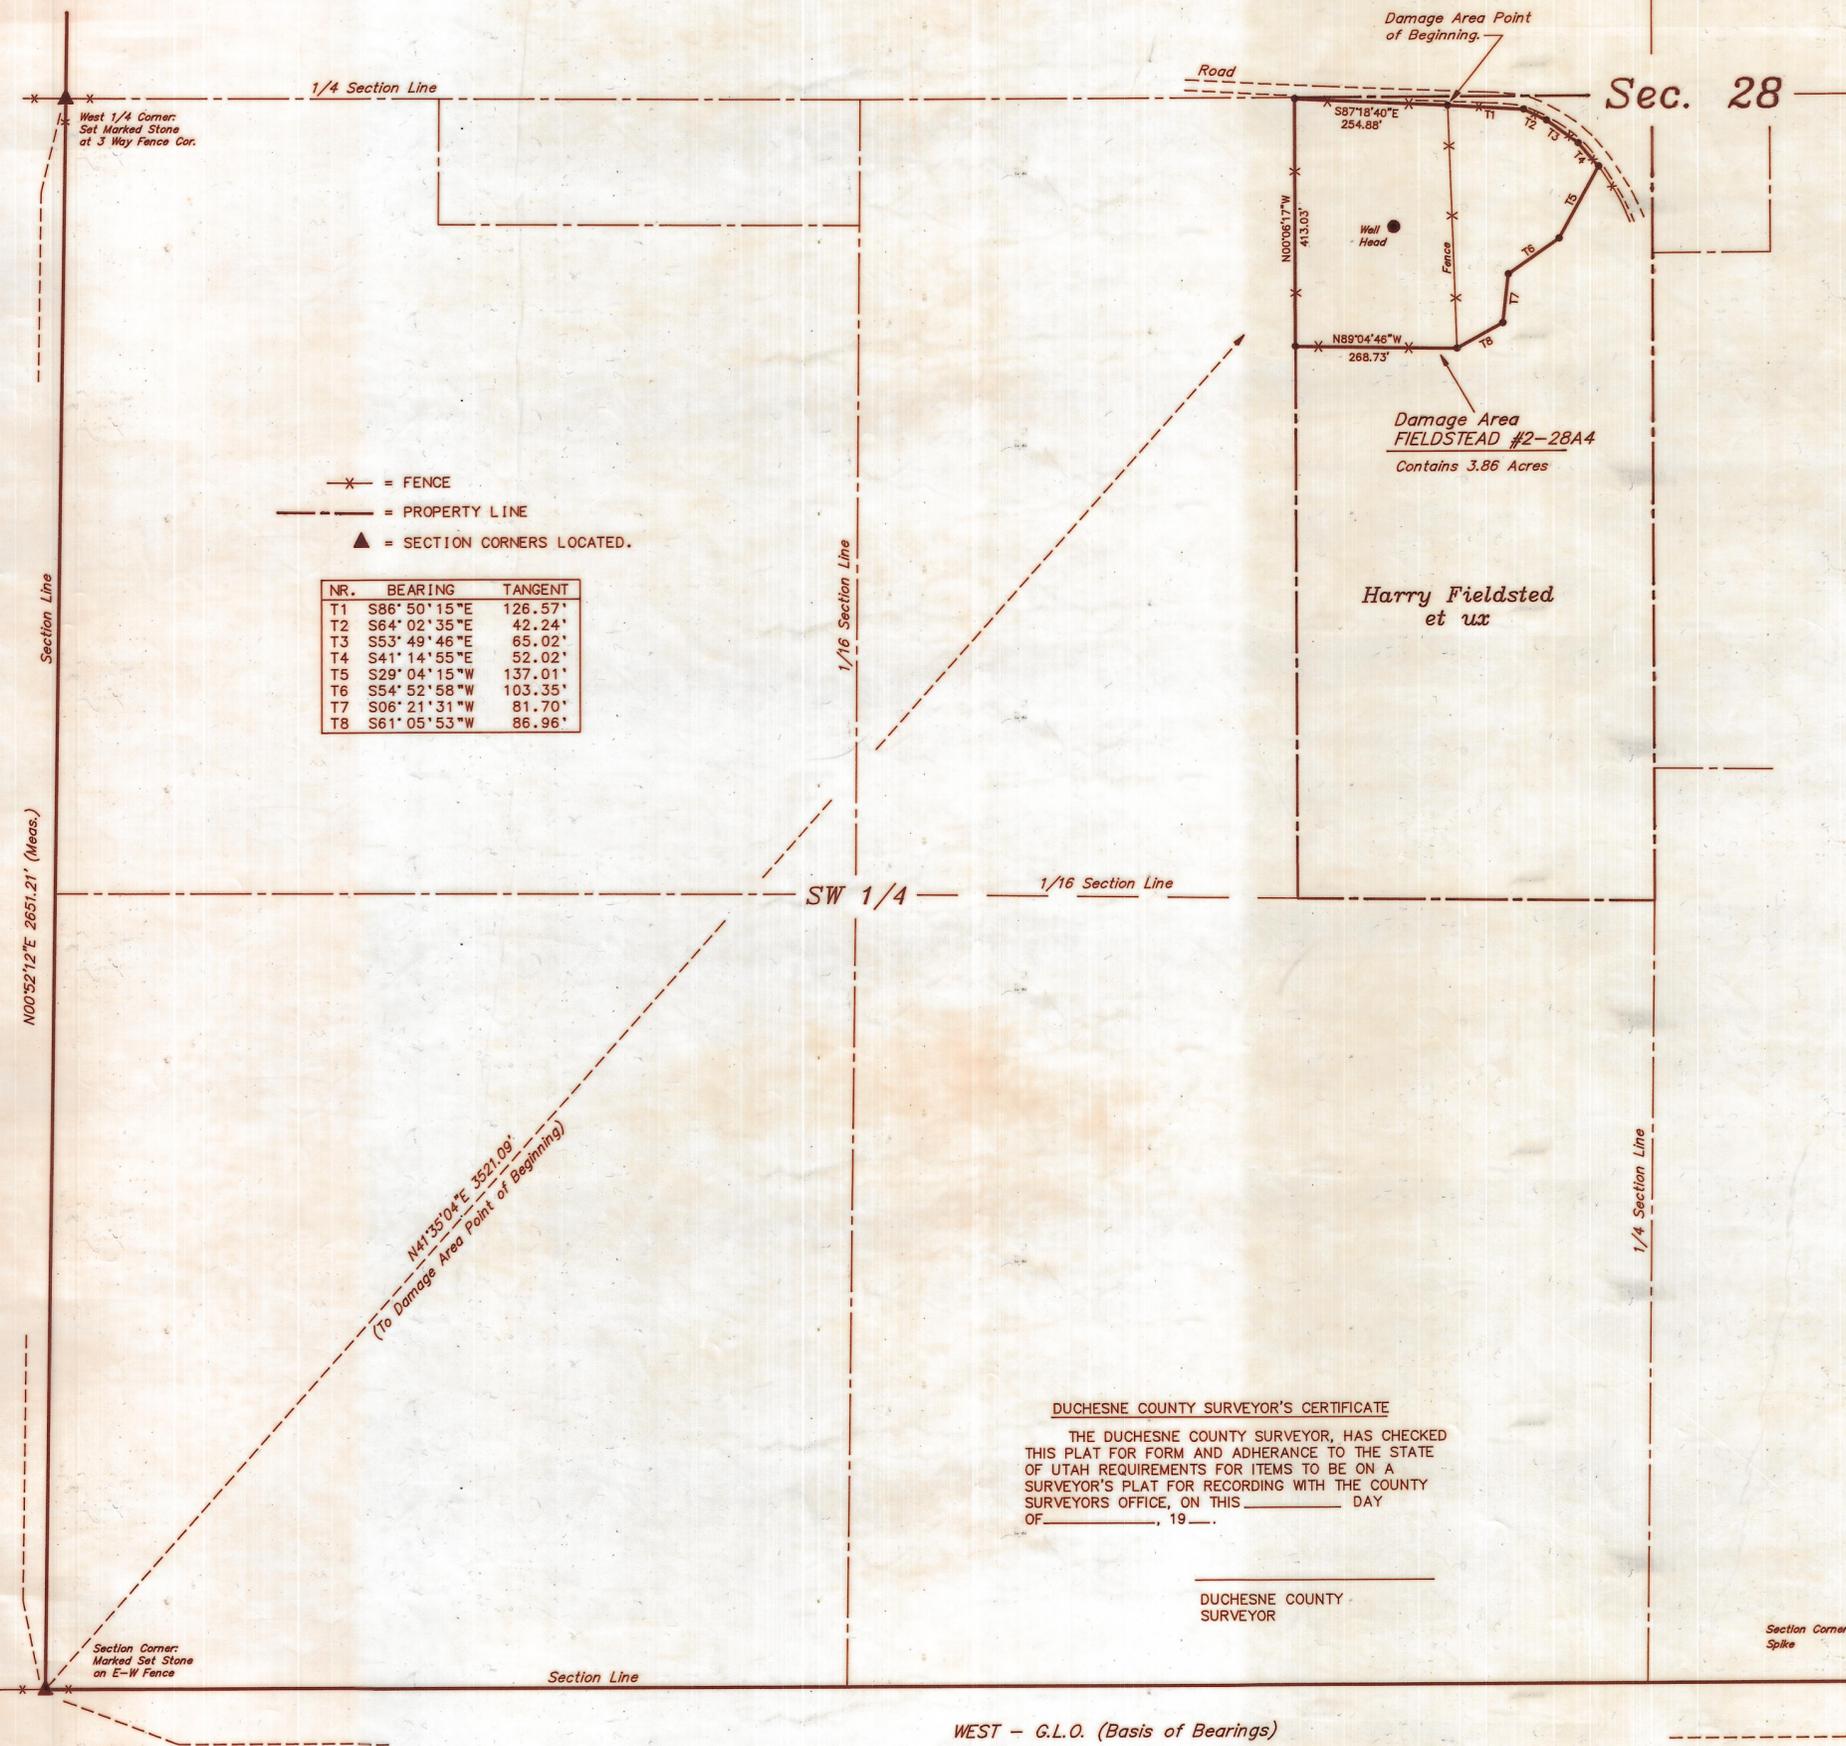

* = FENCE
 - - - = PROPERTY LINE
 ▲ = SECTION CORNERS LOCATED.

NR.	BEARING	TANGENT
T1	S86° 50' 15" E	126.57'
T2	S64° 02' 35" E	42.24'
T3	S53° 49' 46" E	65.02'
T4	S41° 14' 55" E	52.02'
T5	S29° 04' 15" W	137.01'
T6	S54° 52' 58" W	103.35'
T7	S06° 21' 31" W	81.70'
T8	S61° 05' 53" W	86.96'

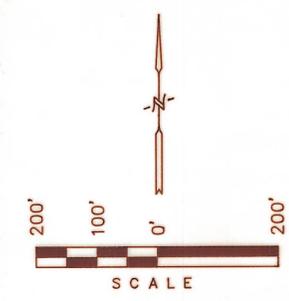

DAMAGE AREA DESCRIPTION

BEGINNING AT A FENCE CORNER IN THE SW 1/4 OF SECTION 28, T1S, R4W, U.S.B.&M. WHICH BEARS N41°35'04"E 3521.09' FROM THE SOUTHWEST CORNER OF SAID SECTION, THENCE THE FOLLOWING FOUR CALLS ALONG THE SOUTHERN RIGHT-OF-WAY FENCE OF A ROAD, S86°50'15"E 126.57', S64°02'35"E 42.24', S53°49'46"E 65.02', S41°14'55"E 52.02'; THENCE S29°04'15"W 137.01'; THENCE S54°52'58"W 103.35'; THENCE S06°21'31"W 81.70'; THENCE S61°05'53"W 86.96' TO A FENCE CORNER; THENCE N89°04'46"W ALONG A FENCE 268.73' MORE OR LESS TO THE GRANTOR'S WEST PROPERTY LINE; THENCE N00°06'17"W ALONG THE GRANTOR'S SAID WEST PROPERTY LINE 413.03' MORE OR LESS TO A POINT IN LINE WITH A FENCE BEARING EASTERLY WHICH POINT ALSO BEARS N87°18'40"W FROM THE POINT OF BEGINNING; THENCE S87°18'40"E ALONG THE SAID FENCE 254.88' MORE OR LESS TO THE POINT OF BEGINNING. BASIS OF BEARINGS IS THE SOUTH LINE OF SAID SECTION 28 WHICH IS ASSUMED FROM G.L.O. INFORMATION TO BEAR WEST. CONTAINS 3.86 ACRES MORE OR LESS.

SURVEYOR'S NARRATIVE

ANR PRODUCTION CO. REQUESTED THAT WE SURVEY THE DAMAGE AREA OF THE FIELDSTEAD #2-28A4 WELL SITE.

AS CONTROL FOR THIS SURVEY WE USED THE SECTION CORNERS SHOWN AS LOCATED HEREON. AS BASIS OF BEARINGS FOR THIS SURVEY WE ASSUMED THE G.L.O. BEARING OF WEST ALONG THE SOUTH LINE OF SAID SECTION.

TO DETERMINE THE APPROXIMATE LOCATION OF THE GRANTOR'S WEST PROPERTY LINE WE USED G.L.O. INFORMATION AND FIELD DATA.

CERTIFICATE

THIS IS TO CERTIFY THAT THE ABOVE PLAT WAS PREPARED FROM FIELD NOTES OF ACTUAL SURVEYS MADE BY ME OR UNDER MY SUPERVISION AND THAT THE SAME ARE TRUE AND CORRECT TO THE BEST OF MY KNOWLEDGE AND BELIEF.


 REGISTERED LAND SURVEYOR
 REGISTRATION NO. 5709
 STATE OF UTAH

DUCESNE COUNTY SURVEYOR'S CERTIFICATE

THE DUCESNE COUNTY SURVEYOR, HAS CHECKED THIS PLAT FOR FORM AND ADHERANCE TO THE STATE OF UTAH REQUIREMENTS FOR ITEMS TO BE ON A SURVEYOR'S PLAT FOR RECORDING WITH THE COUNTY SURVEYORS OFFICE, ON THIS _____ DAY OF _____, 19____.

DUCESNE COUNTY SURVEYOR

1 Jan '94 Duchesne County Surveyor File # 338


UTAH ENGINEERING & LAND SURVEYING
 PHONE: (801) 789-1017
 85 SOUTH 200 EAST - VERNAL, UTAH 84078

SCALE: 1" = 200'	DATE SURVEYED: 6-26-92	DATE DRAWN: 7-7-92
SURVEYED BY: L.D.T. D.S.	DRAWN BY: J.R.S.	
WEATHER: WARM	FILE: 3 0 1 9 2	

WEST - G.L.O. (Basis of Bearings)
5328.61' (Measured)

Section Corner Spike $\frac{28}{33} \frac{27}{34}$